

Unique Id: 009D81A1-6F3D9E80-1C02A1

' Copyright 1999 Compaq Computer Corporation. All rights reserved

SOURCE: Compaq Computer Corporation INFORMATION BLITZ

INFORMATION BLITZ TITLE:

AlphaServer GS60/GS140 Console Upgrade from AlphaSystems Firmware CD V5.4

DATE: May 10, 1999

INFORMATION BLITZ #: TD 2651-CR

\ AUTHORS: Roger Allen David Hoffman  
\ TEL#: dtn: 223-6254 dtn 223-4711  
\ (978)493-6254 (978)493-4711  
\ EMAIL: roger.allen@compaq.com david.hoffman@compaq.com  
DEPARTMENT: AlphaServers, HPSD  
=====

PRODUCT NAME(S) IMPACTED: AlphaServer GS60/GS140

PRODUCT FAMILY(IES):

Storage  
Systems X  
Networks  
PC  
Software  
Other (specify)

PRODUCT NUMBERS: AlphaServer GS60, AlphaServer GS140

PROBLEM STATEMENT:

Following the standard procedure to boot the AlphaSystems Firmware Update CD V5.4 on AlphaServer GS60 and GS140 systems may intermittently fail.

PROBLEM SYMPTOM:

After booting the CD and after the program reports

"Starting new console, Please wait a minute..."

an error message like the following example may sometimes be reported:

\*\*\* Console Error, CPU 4, Restarting \*\*\*  
halt code = 2, PC = 1a730

SOLUTION:

If this occurs on your system, you can use the CD to perform the firmware update, by using the following workaround procedure:

- 1) Re-initialize the system via the "init" console command.
- 2) Enter the "lfu" command at the console prompt, and respond to the prompts as shown in the following example :

P00>>>lfu

\*\*\*\*\* Loadable Firmware Update Utility \*\*\*\*\*

Select firmware load device (cda0, dva0, ewa0), or  
Press <return> to bypass loading and proceed to LFU: cda0

Please enter the name of the firmware files list, or  
Press <return> to use the default filename [GS140FW]: <hit enter key>

Copying GS140FW from DKB400.4.0.6.1 .  
Copying [gs140]T6README from DKB400.4.0.6.1 .  
Copying [gs140]T6SRMROM from DKB400.4.0.6.1 ..  
.  
<etc., etc., Firmware Update Program starts>  
. .  
.

UPD>

- 3) From this point on, you can run the update program in the normal manner.

ADDITIONAL COMMENTS:

The problem will be corrected in the next release.

\*\*\*\*\*< NOTE >\*\*\*\*\*  
\*  
\* INFORMATION IN THIS DOCUMENT REPRESENTS OPERATIONAL EXPERIENCES AND \*  
\* SUGGESTIONS BY COMPAQ OR PARTNER EMPLOYEES. COMPAQ SHALL NOT BE \*  
\* RESPONSIBLE FOR ANY ERRORS OR OMISSIONS CONTAINED IN THIS DOCUMENT, \*  
\* AND RESERVES THE RIGHT TO MAKE CHANGES TO IT WITHOUT NOTICE. \*  
\*  
\*\*\*\*\*

<>UPDATE /TEXT\_UPDATE/UNIQUE\_IDENTIFIER="009D81A1-6F3D9E80-1C02A1"-  
/TITLE="[ TD 2651-CR ] AlphaServer GS60/GS140 Console Upgrade /Firmware CD V5.4 - BLITZ"  
/BADGE=(AUTHOR="999997",ENTER="166500",MODIFY=" ",-  
EDITORIAL REVIEW="166500",TECHNICAL REVIEW="999997")-  
/NAME=(AUTHOR="ROGER ALLEN",ENTER="LAURIE REILLY",-  
MODIFY=" ",EDITORIAL REVIEW="LAURIE REILLY",TECHNICAL REVIEW="ROGER ALLEN")-  
/DATE=(AUTHOR="14-MAY-1999",ENTER="14-MAY-1999",-

EXPIRE="14-MAY-2001",FLASH="14-MAY-1999 14:49:29.96",MODIFY="17-NOV-1858",-  
EDITORIAL REVIEW="14-MAY-1999",TECHNICAL REVIEW="14-MAY-1999")-  
/GEOGRAPHY="USA"/SITE="EIRS"/OWNER="TIM-BLITZ"-  
/FLAGS=(USA\_CUSTOMER\_READABLE,NOPOST\_MESSAGE\_DISPLAY,NOLOCAL,-  
EUR\_CUSTOMER\_READABLE,GIA\_CUSTOMER\_READABLE,NOINIT\_MESSAGE\_DISPLAY,-  
EDITORIAL REVIEWED,FIELD\_READABLE,FLASH,TECHNICAL REVIEWED,READY)